



Modern Coach Factory Raebareli  
आधुनिक रेल डिब्बा कारखाना, रायबरेली

DOC NO.: MCF/RBL/QMF 8002  
REV NO: 01  
DATE: 17.04.2018

ROLLING STOCK CERTIFICATE (DEEN DAYALU)

Rolling Stock Certificate No.: MCF/RBL/QC/RSC/2020-21 /1247

RLY	WCR	COACH NO	215518/C	DATE OF DISPATCH	12-Mar-21
Type	LWS	Shell No.	20F184	DISPATCH TO	Sr.DME/C&W/JBP
				FUR.NO.	DDG-636

1. Railway Board's Order No. 2019/M (C)/142/2, Date- 03.09.2019

2. Tare weight of coach : 40.66 Tonnes

3. Carrying Capacity : (a) Seating: 100 (c) Luggage: NIL

4. Special feature:

S NO	ITEMS	MAKE/SUPPLIER
A	Cushion transverse side luggage rack which can serve as seat during rush	M/S-NITIN NDLS
B	Honey comb partition frame.	M/S-MILTON LTD
C	DGFRP/GFRE paneling.	M/S-MCF/RBL
D	Lavatory with DGFRP/GFRE paneling.	M/S-MCF/RBL
E	Additional Hand hold.	M/S-MCF/RBL
F	Counter top wash basin.	M/S-MCF/RBL
G	Gel coating & Anti Graffiti measures.	M/S-MCF/RBL
H	Air spring in secondary suspension (capacity-140KN).	M/S-RESISTOFLEX +TAYAL &CO
I	Fire Extinguishers	M/S-AMTEX INDS
J	Vestibule ends for inter-coach movement of passenger and the service staff (LWSCN type End wall)	
K	Choke of 5/6 mm in DV side replace with 9 mm in both type (KBI & Faiv.) letter no. MC/LHB/Brake, DT. 27.09.18	

5. SHELL LEADING DIMENSIONS:

S NO	DESCRIPTION	DIMENSION (MM)
1	Maximum length over body	23700
2	Maximum width over body	3240
3	Maximum height from Rail Level	4039
4	CBC height/Buffer height from Rail level 1105 +0/-10	NPP/PP 1097/1102

6. TRACEABILITY OF SHELL ITEMS:

S NO	ITEM	MAKE/SUPPLIER	SERIAL NO
1	Under frame	Front PP END M/S-NE CHD Part NPP END M/S-JBIMI Complete MCF/RBL- AIRCON	---- ---- 20F184
2	Lav. side wall	PP END M/S-DTL PUNE NPP END M/S-DTL PUNE	LAV.1 ----- LAV.2 ----- LAV.3 ----- LAV.4 -----
3	Side wall	LH SIDE MCF/RBL-V4U LKO RH SIDE MCF/RBL-V4U LKO	58 58
4	End wall	PP END M/S-OMAX REWARI NPP END M/S-P.D.STEEL	----- -----
5	Roof	M/S-UNIVERSAL	37
6	Centre Buffer Coupler	M/S-FRONTIETR	PP END/ NPP END 61P1,77P1

7. AIR BRAKE TEST REPORT:

S NO	ITEM	DESCRIPTION	SPEC. VALUE	OBSERVED
1	Full brake application	Reduce pressure of BP from 5.0 to 3.4 kg/cm <sup>2</sup> . Max. pressure in BC All Brake are applied	6 – 10 sec. 3.0 ±0.15 kg/cm <sup>2</sup> . OK	8 Sec 3.0 kg/cm <sup>2</sup> OK
2	Insensitivity	Exhaust BP @ 0.3 kg/cm <sup>2</sup> /min.	No brake application	OK
3	Sensitivity	Exhaust BP @ 0.1 kg/cm <sup>2</sup> /Sec, after 06 Sec.	Brake must apply	OK

8. PAINTING DETAILS:

S NO	DESCRIPTION	TYPE OF PAINT	MAKE	APPLICATION BY MCF/ CONTRACTOR (SUPPLY & APPLY)	AVERAGE GLOSS VALUE	DATE OF COMPLETION
1	Paint	P.U	VIBGYOR	M/S-VIBGYOR	75/89	8-Mar-21
2	Insulation			Satisfactory		

03/07/21  
SSE/QC/MCF/RBL

वरिष्ठ अनुष्ठानिक अधिकारी  
गुणवत्ता विभाग  
रेलवे डिपार्टमेंट, रायबरेली (लालगंज)





MODERN COACH FACTORY, RAEBARELI

आधुनिक रेल डिब्बा कारखाना, रायबरेली

DOC NO.: MCF/RBL/QMF 8002

REV NO.: 01

DATE: 16.05.2016

**ROLLING STOCK CERTIFICATE****Rolling Stock Certificate No.: MCF/RBL/QC/RSC/2020-21 - 1247**

RLY	W	C	R	-	Coach No.	2	1	5	5	1	8	/	C	-	DATE OF DISPATCH	1	2	0	3	2	0	2	1
-----	---	---	---	---	-----------	---	---	---	---	---	---	---	---	---	------------------	---	---	---	---	---	---	---	---

DISPATCH	Sr.DME/C&W/IBP	Type	L	W	S	-	-	-	Shell No.	2	0	F	1	8	4	FUR .NO	DDG- 636
----------	----------------	------	---	---	---	---	---	---	-----------	---	---	---	---	---	---	---------	----------

**9. DETAIL OF BOGIES:**

ITEMS	NPP Side				PP Side			
Bogie No	202692				202691			
Bogie Type	LWS				LWS			
Frame no.	W.I.L - 595				W.I.L - 609			
Bolster no.	MCF/RBL/LS5- 3167				MCF/RBL/LS-5 - 2887			
Axle No	21 C - 4322 RWF		21 C - 4399 RWF		21 C - 4257 RWF		21 C - 4191 RWF	
Wheel Dia	917.48	917.498	917.521	917.483	917.389	917.457	917.477	917.484
Wheel Disc No	TZ 09-20 33061-OTE1	TZ 09-20 33798-OTC8	TZ 09-20 29984-OTC8	TZ 09-20 29207-OTD1	TZ 09-20 25708-0SE0	TZ 09-20 25710-0SE0	TZ 09-20 33801-OTC8	TZ 09-20 33799-OTC8
R.B. Nos.	03-20 408060	06-20 412078	03-20 409226	06-20 413039	03-20 502428	06-20 411773	06-20 411192	06-20 412000
CT R B Make	TIMKEN		TIMKEN		TIMKEN		TIMKEN	

**10. SECONDARY SUSPENSION LOAD DEFLECTION VALUES :-**

DESCRIPTION	Bogie NPP side		Bogie PP side	
	Secondary 1	Secondary 2	Secondary 1	Secondary 2
Make & Nos.	TAYAL & CO. S. NO. 02-20 8802	TAYAL & CO. S. NO. 02-20 8205	RESISTROFLEX 07-20 15447	RESISTROFLEX 06-20 15393

**11. TRACEABILITY OF BOGIE ITEMS :-**

S. NO	ITEM	MAKE/ SUPPLIER	SERIAL NO.	
			NPP SIDE	PP SIDE
1.	Yaw Damper	ESCORTS	8025,7949	8228,8022
2.	Primary outer Spring	CMAFI	07-20-1100-(120,121,91,68)	07-20-1100-(208,100,211,98)
3.	Primary Inner Spring	CMAFI	07-20-1101-(56,45,55,42)	07-20-1101-(49,141,131,143)
4.	Primary Damper	IAI	01-20 (301285,300174,298478,298653)	01-20-(300588,299032,300492,299936)
5.	Secondary Damper	IAI	06-20 (326921,323630)	06-20 (326775,322128)
6.	Lateral Damper	IAI	11-19 283630	11-19 283711
7.	Brake Cylinder	FAV	G20-(021,032), F20-(400,546)	K20-(319,315), B21-(045,019)
8.	Brake Caliper	FAV	H20-(108,106,105,107)-B	B21-(454,451,452,453)-B
9.	Brake Disc	KBI	24243855-0031-5020,24243855-0038-50-20, 24247026-0060-02-21,24247024-003502-21	24247026-0005-2-21,24247026-0004-2-21, 24247038-0045-01-21,24247038-0044-01-20
10.	Ball Joint Control Arm	BONY		
11.	Lateral Bump Stop	AR/BONY		
12.	Traction Centre make	RNG		
13.	Traction lever make	TAJ		
14.	Ball joint traction lever	BONY		
15.	Ball joint traction centre	BONY		
16.	Leveling Valve	FAV	C20-(723,722)	K19-(744,568)
17.	Check Valve	FAV	G20-002	M19-186
18.	Anti roll bar Make	SF		
19.	Roll Link make	RF+BONY		
20.	Fork make	RNG		
21.	Control Arm Upper	CC	20F-295,20G4,20F-266,20H-104	20F-213,20G-559,20H-142,20F-304
22.	Control Arm Lower	CC	20G-167,20H-252,20L-305,19L-108	20G-208,19L-135,20G-265,20H-107
23.	Phonic Wheel	FAV	FT/KEP-70	FT/KEP-600

Signature of SSE 'Bogie/QC





Modern Coach Factory Raebareli  
आधुनिक रेल डिब्बा कारखाना, रायबरेली

DOC NO.: MCF/RBL/QMF 8002  
REV NO: 01  
DATE: 17.04.2018





ROLLING STOCK CERTIFICATE (DEEN DAYALU)  
Rolling Stock Certificate No.: MCF/RBL/QC/RSC/2020-21

RLY	WCR	COACH NO	215518/C	DATE OF DISPATCH	12-Mar-21
Type	LWS	Shell No.	20F184	DISPATCH TO	Sr.DME/C&W/JBP
				FUR.NO.	DDG-636

12. TRACEABILITY OF FURNISHING ITEMS:

S NO	ITEM	MAKE/SUPPLIER	SERIAL NO(NPP/PP)
1	Air Brake Module	M/S-FAIVELEY	B21045B
2	Distribution valve	M/S-FAIVELEY	B215551B
3	Pull box	M/S-KBI	
4	FIBA	M/S-KBI	12380/29,12381/29
5	Foot Step	M/S-FABRICON INDS KOLKATA	
6	Decoupling arrangement	M/S-PULSAR INDS KOLKATA	
7	Floor board	M/S-SHREE RAM PNL	
11	UIC Vestibule (NPPE)	M/S-ELASTOMER MUMBAI	
12	Gangway bridge mounting (PPE)	M/s- MAHAVEER METAL WORKS, KXH	
13	Gangway bridge mounting (NPPE)	M/s- MAHAVEER METAL WORKS, KXH	
14	Body Side Window	M/S-SHATABDI VADODARA	
15	Emergency Window	M/S-SHATABDI VADODARA	
16	Lavatory/hopper Window	M/s-AIKON HP	
17	Roof Ceiling ACP	M/s-A.B.COMPOSITE	
18	Door way /gang way ceiling ACP	M/s-A.B.COMPOSITE	
19	Body Side Doors	M/S-MSL MOHALI(2,4,5,6)+JVR LDH(1,3)	
20	Vestibule Door(PPE)	M/s-KALSI LDH	
21	Vestibule Door(NPPE)	M/s-KALSI LDH	
22	Bio Tank	M/s-RASANDIK-02 NOS+UNIFAB -02 NOS	
23	Pressurized flushing(ele.pneu.)	M/S-OASIS	
24	Over head water tank (4x390L)	M/S-FABRICATORS	
25	Bib cock/controlled discharge tap	M/S-AGMECO U.K.	
26	Lavatory Doors	M/S-JVR LDH (1,3)+MSL MOHALI(2,4)	
27	Fire Extinguisher	M/S-AMTEX INDS	26449,26690
28	Water purified (02 nos)	NIL	
29	Seat & Berth	M/S-OVPL MUMBAI	
30	Luggage Rack	M/S-NITIN NDLS	
31	Light Luggage Rack	NIL	
32	Ventury grill	NIL	
33	RFID	NIL	

03/07/21  
वरिष्ठ अधिकारी  
SSE/QC/MCF/RBL  
गुणवत्ता विभाग  
रेडिओका, रायबरेली (लालगंज)

		<b>Modern Coach Factory Raebareilly</b> <b>आधुनिक रेल डिब्बा कारखाना, रायबरेली</b>		DOC NO.: MCF/RBL/QMF 8002 REV NO: 01 DATE: 17.04.2018		
ROLLING STOCK CERTIFICATE (DEEN DAYALU) Rolling Stock Certificate No.: MCF/RBL/QC/RSC/2020-21						
RLY	WCR	COACH NO	215518/C	DATE OF DISPATCH		12-Mar-21
Type	LWS	Shell No.	20F184	DISPATCH TO	Sr.DME/C&W/JBP	FUR.NO. DDG-636
13. MODIFICATION (IF ANY) : NIL 14. DEVIATION (IF ANY) : NIL 15. ITEM FITTED ON THE COACH ON TRIAL : NIL						
S NO	ITEM PARTICULARS		PURPOSE	REPORT Frequency	REFERENCE & PERIOD OF TRIAL	
--	--		---	----	-----	
16. WARRANTY:						
S NO	COMPONENTS			WARRANTY		
1	Brake Pad, wheels, flushing valves, push gravity cocks, moldings, window glasses, mirrors, curtain clutch wire etc. ( items which are consumable in nature)			NIL		
2	Other coach furnishing sub assemblies(bought out items)			24 months from the date of dispatch of coach OR 30months from the date of supply of material whichever is earlier.		
NOTE: 1. This warranty covers free supply of parts which wear out and fails within warranty period of normal service. 2. This doesn't covers faults arising out of accident, non standard maintenance practices, abnormal use or mishandling, vandal activity, arson & deficient/pilferage etc. 3. This doesn't cover any consequential liabilities or damages/loss incurred by anybody; furthermore, it shall in no case extend to repayment, return of the coach or replacement of complete coach. 4. Whether a defective part is to be replaced or repaired shall be at the discretion of MCF/RBL. 5. For any complain/ suggestion please Mail at qualityrcfbl@gmail.com 6. Painting on supply & apply contract :- supply of material and application shall be warranted for a period of three years from Application for any manufacturing /Application as per clause -4, para- V of RDSO specification no .M&C/PCN/100/2013-Given below						
S.No	Time period	Gloss Retention (initial gloss >85 unit at 60°)	Colour Retention rating on 0-10 scale (initial rating of painted panels/coach or ISC/RAL shade card shall be taken as 10)	Adherence of paints (with each other and with substrate ) Cross-cut tape adhesion test as per ASTM D:3359/97(or latest)		
1	After 1 year	80% of initial gloss	7	5B		
2	After 2 year	70% of initial gloss	6	5B		
3	After 3 year	60% of initial gloss	5	4B		
If any imperfection is noticed or any defect arises during the warranty -period due to improper material used or due to bad workmanship, the contractor shall be bounded to set right the defect/ imperfection on free of cost basis at the base depot of the coach.						
 03/07/21		 3-7-2021		 3-7-2021		
SSE/QC/MCF/RBL वरिष्ठ अनुसंधान अभियंता गुणवत्ता विभाग रेडि०का०, रायबरेली (लालगंज)		SME/AME/QC/MCF/RBL Asst. Mechanical Engineer आ. रे. डि. का. रायबरेली MCF, RBL		Dy.CQM/MCF/RBL Dy. Chief Quality Manager आधुनिक रेल डिब्बा कारखाना, रायबरेली Modern Coach Factory, Raebareilly		





# Vibgyor Paints & Chemicals Pondicherry

Office : Sri Balaji Apartments, 87/47, Harrington Road,  
Shenoy Nagar, Chennai - 600 030.  
Web : [www.vibgyorpaintspondicherry.com](http://www.vibgyorpaintspondicherry.com)

ISO : 9001 : 2015  
ISO : 14001 : 2015  
Certified Company

## WARRANTY CERTIFICATE

To,

DY.CME/FUR/PAINT  
MODERN COACH FACTORY  
RAEBARELI, LALGANJ- 229120

Date:- 09/03/2021

SUBJECT: -PERFORMANCE WARRANTY CERTIFICATE

REF: PO NO: 06190055100701 dated 20.05.2020

NAME OF WORK: SUPPLY AND APPLY OF EXTERIOR PAINT OF LHB TYPE SEEN DAYALU COACHES

Dear Sir,

With reference to above, we do here by confirm the warranty for Three years from the date of application of the delivered below mention coaches vide your above referred purchase order after application & date inspection at your end.

SL.NO	SHELL NO	FURNISHING NO	COACH NO	RAILWAY NO	DATE OF COMPLETION
12	LWSDG 20 F184	DDG 636	215518	WCR	18/02/2021 08/03/2021

The warranty is applicable from date of despatch against the below mention defects as per RDSC Specification no. M&C/PCN/100/2013.

Gloss level value of applied paint initial 85unit (on the date of painting) and minimum 80% 70% 860N of initial gloss after one year, two years, three years respectively from the date of application.

Decolonization of paint film.  
Cracking of paint film  
Peeling of paint film  
Blistering of the paint film



Thanking You

For Vibgyor paints & chemicals Pondicherry  
Authorized Signatory

Factory : S-51, Phase III, Sipcot Industrial Complex, Nellikuppam, Ranipet - 632 405.  
Ph : +91-4172-241478, Fax : +91-4172-242478, E-mail : [vpdpdyr@yahoo.in](mailto:vpdpdyr@yahoo.in), [ramuvibgyor@yahoo.in](mailto:ramuvibgyor@yahoo.in)

**We have Solutions for Ecofriendly Industrial Coatings**





	<b>Modern Coach Factory Raebareli</b> <b>आधुनिकरेलडिब्बाकारखाना, रायबरेली</b>	DOC NO.: MCF/RBL/QEF/8001
		REV NO: 01
		DATE: 29.06.2020

PAGE 1 OF 4

**FOR ELECTRICAL ITEMS**

ROLLING STOCK CERTIFICATE OF LHB EOG NON AC GS COACH  
(ANTYODAYA & DEENDAYALU).

ELECTRICAL TEST CERTIFICATE FOR LHB EOG NON AC GS COACH.


TYPE COACH	LWS/DDG	SHELL/COACH NO	215518/C
RAILWAY	WCR	ELECT. FIT DATE	11-03-2021 MCF FUR. NO.
			DDG - 636
Sr. no.	Description of tests		Remarks
1.	WORKING OF COMPARTMENT LIGHTS.		OK
2.	WORKING OF MOBILE CHARGING SOCKETS		OK
3.	WORKING OF ACCIDENTAL EMERGENCY LIGHTS& PACIL		OK
4.	RAILWAY CARRIAGE FAN		OK
5.	WHEEL SLIDE PROTECTION SYSTEM ( WSP )		OK
6.	WORKING OF 9 KVA TRANSFORMER		OK
7.	WORKING OF REGULATED BATTERY CHARGER/EMERGENCY BATTERY CHARGER.		OK
8.	SAFETY :		--
8.1.	FUSES AND THEIR RATING		OK
8.2	CONTROL CIRCUIT		OK
8.3	POWER CIRCUIT		OK

**Senior Section Engineer**  
**Quality control / Electrical**  
**Modern Coach Factory Raebareli**








	<b>Modern Coach Factory Raebareli</b> <b>आधुनिकरेलडिब्बाकारखाना, रायबरेली</b>	DOC NO.: MCF/RBL/QEF/8001
		REV NO: 01
		DATE: 29.06.2020

PAGE 2 OF 4

ROLLING STOCK CERTIFICATE OF LHB/EOG NONAC GS COACHES  
(ANTYODAYA & DEENDAYALU).

Sr. no.	Description	Drg./Spec no.	Quantity per Coach
01.	Fitment of Switch board cabinet.(set of panel) Make/Sr.no.: <b>HIND</b> On Board: <b>H355.19F.0310</b> HT Panel: <b>H355.20E.0738</b>	EDTS 333, Rev`01`.Am-1	<b>01 SET</b>
02.	Provision of 9 KVA 750/415/190V, 03Ø AC. Make : <b>VIMAL</b> Sr no.: <b>VTC 3089 LHB 4471</b>	RDSO/PE/SPEC/TL 0158, 2010, Rev`0`,Ty I.	<b>01</b>
03.	Mounting of 09KVA TFR.	As per drg no 1.10113.0.76.300.001,Alt -B.	OK
04.	Provision of wire rope assembly for Transformer.	As per EDML-152, Rev.-Nil.	OK
05.	4.5 Kw Under slung type Constant Voltage Regulated Battery charger cum Emergency battery charger Make: <b>SIGNOTRON</b> Sr. no.: <b>08201743</b>	As per spec no. RDSO/PE/SPEC/AC/0183-2015(REV.-1)	<b>01</b>
06.	Provision of Feeder Junction Box Make : <b>SYSTEMS &amp; SERVICES</b>	EDTS-328 REV-C,AM-4,Type-II,COR-2	<b>01 SET</b>
07.	Provision of IVC dummy Socket assembly.	As per Drg. No. LW71302,Alt-nil	<b>01 SET</b>
08.	Battery fuse box +ve Make : <b>INDORAIL</b>	As per LW 71001,Alt- H	<b>01</b>
09.	Battery fuse box -ve Make : <b>AECO</b>	As per LW 71002,Alt-I	<b>01</b>
10.	Provision of Battery boxes/ Cradles. Make: <b>HITECH</b>	As per Drg. No. 110113.0.76.700.005 W/O item 5,22,23,26 & 27,Alt-C or Latest.	<b>01</b>
11.	Provision of batteries Type:110 V, 120 AH VRLA SMF Battery Set. Make: <b>AMARA RAJA</b> Lug Date: 06/20	As per RDSO/PE/SPEC/AC/0009-2014 (Rev-2) with inner cell connectors or Latest.	<b>01</b>

  
**Senior Section Engineer**  
**Quality control / Electrical**  
**Modern Coach Factory Raebareli**





	<b>Modern Coach Factory Raebareli</b> <b>आधुनिकरेलडिब्बाकारखाना, रायबरेली</b>	DOC NO.: MCF/RBL/QEF/8001
		REV NO: 01
		DATE: 29.06.2020

PAGE 3 OF 4


**ROLLING STOCK CERTIFICATE OF LHB/EOG NONAC GS COACHES**  
**(ANTYODAYA & DEENDAYALU).**

Sr. no.	Description	Drg./Spec no.	Quantity per Coach
12.	Fitment of Railway carriage Fan 400mm Sweep, 110V AC with crash worthy features. Make: <b>KAPSONS</b>	As per Drg. No. ICF/SK-7-6-158,alt-g. RDSO/PE/SPEC/TL/0021-2005 (Rev-3) with RCF annex-1,am-1.	<b>30</b>
13.	Fitment of LED Light fittings for Cabin, Doorway and Gangway area. 9 watt. Make: <b>RT VISION</b>	As per RDSO/PE/SPEC/TL/0091-2016,Rev-1 with RCF Annex-1 .Type-B1. Drg. No. CC76453.	<b>28</b>
14.	Fitment of LED Light fittings for Lavatory Lights. 9 Watt. Make: <b>DR AUTO</b>	As per RDSO/PE/SPEC/TL/0091-2016,Rev-1 with RCF Annex-1Type-D. Drg. No. LW76092.	<b>04</b>
15.	Fitment of LED Light fittings for PACIL. Make: <b>AGASTYA</b>	As per RDSO/SPEC/TL/0091-2016,Rev-1 with RCF Annex-1Type-I. Drg. No. LW76098.	<b>02</b>
16.	Fitment of Accidental Emergency Light (AEL) Make: <b>INTEG</b>	As per RDSO/SPEC/AC/0180-2016,Rev-0 ,Type-II.	<b>04</b>
17.	Provision of Cable binder	Drg. No. CC76120,Item - 1,2,3.100mm,200mm,300mm respectively.	<b>OK</b>
18.	Provision of Cable Jacket System.	EDTS-138,Cor-2,Item-5,7,8,9,11.	<b>OK</b>
19.	Provision of Switch plate assembly along with mobile charging sockets. Make: <b>SSK</b>	EDML-086, Rev-6, Am-1, Table-1, Item-1.	<b>10</b>

**Senior Section Engineer**  
**Quality control / Electrical**  
**Modern Coach Factory Raebareli**




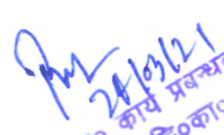


	<b>Modern Coach Factory Raebareli</b> <b>आधुनिकरेलडिब्बाकारखाना, रायबरेली</b>	DOC NO.: MCF/RBL/QEF/8001
		REV NO: 01
		DATE: 29.06.2020

PAGE 4 OF 4

ROLLING STOCK CERTIFICATE OF LHB/EOG NONAC GS COACHES  
(ANTYODAYA & DEENDAYALU).

Sr. no.	Description	Drg./Spec no.	Quantity per Coach
20.	Provision of Switch plate assembly along with mobile charging sockets. Make: <b>SSK</b>	EDML-086, Rev-6, Am-1, Table-1, Item-2.	<b>10</b>
21.	Provision of High Capacity Inter – Vehicular Coupler Unit (ZS Coupling) (500 A, 750 V, 3ph, 50 Hz). Make: 1.(NPP): <b>PRIME ELECT.</b> 2.(PP): <b>PRIME ELECT.</b>	As per Spec. no. RDSO/PE/SPEC/AC/0177(Rev.-0)-2013 with annexure-A, B.	<b>1 SET</b>
22.	Mounting of Inter Vehicle coupler	As per drg no.1.10113.0.74.000.001,Alt-B	<b>OK</b>
23.	Provision of Wheel Set Earthing equipment. Make:- NPP: <b>DARSHAN ENTERPRISES</b> PP: <b>DARSHAN ENTERPRISES</b>	EDTS101,REV-C,AM-1	<b>1 SET</b>
24.	Provision of Anti Skid Disk Brake System.(WSP) Make : <b>FAIVELEY</b> Sr no : <b>13062</b>	As per MDTs 077,Rev.-2 M/s"FAIVELEY" or "Knorr Bremse", or "ESCORTS" or" JWL-DAKO-CZ"	<b>01 SET</b>

	
<b>SSE/EL/QC</b> <b>वरिष्ठ अनुभाग अभियन्ता</b> <b>गुणवत्ता नियंत्रण</b> <b>आतरेडि०का० / लालगंज / रायबरेली</b> <b>S.S.E./Elect-QC/M.C.F./LLJ/RBL</b>	<b>AWM(ELECT.)/MCF/RBL</b> <b>SEE(P)/MCF/RBL</b>